

For clients of

lindsays



Home Report



chartered surveyors

Energy Performance Certificate



Energy Performance Certificate (EPC)



1F3, 18 DEAN PARK STREET, EDINBURGH, EH4 1JP

Dwelling type:	Mid-floor flat
Date of assessment:	15 January 2015
Date of certificate:	19 January 2015
Total floor area:	55 m ²


Reference number: Type of assessment: Primary Energy Indicator: Main heating and fuel: 2015-5029-7000-0715-0996 RdSAP, existing dwelling 220 kWh/m²/year Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£1,662	See your recommendations
Over 3 years you could save*	£603	report for more information

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

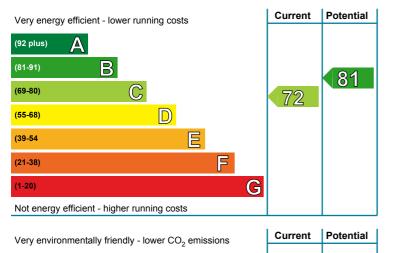

Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Based on calculated energy use of **220** kWh/m²/yr, your current rating is **band C (72)**. The average rating for a home in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Based on calculated emissions of 2 kg CO2/m²/yr, your current rating is **band C (72)**. The average rating for a home in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

85

72

Recommended measures	Indicative cost	Typical savings over 3 years	Available with Green Deal
1 Internal or external wall insulation	£4,000 - £14,000	£192	\bigcirc
2 Low energy lighting	£30	£78	
3 Condensing boiler	£2,200 - £3,000	£135	

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.



(92 plus)

(81-91)

(69-80)

(55-68)

(39-54

(21-38)

(1-20)

B

 \mathbb{C}

Not environmentally friendly - higher CO₂ emissions

D)

E

F

G

The Green Deal may allow you to make your home warmer and cheaper to run at no up-front capital cost. See your recommendations report for more details. THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

1F3 , 18 DEAN PARK STREET, EDINBURGH, EH4 1JP 19 January 2015 RRN: 2015-5029-7000-0715-0996

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	*****	★★☆☆☆
Roof	(another dwelling above)	—	
Floor	(another dwelling below)	_	
Windows	Single glazed	*****	$\bigstar \diamond \diamond \diamond \checkmark \checkmark $
Main heating	Boiler and radiators, mains gas	★★★ ☆	★★★☆
Main heating controls	Programmer, TRVs and bypass	★★★☆☆	★★★☆☆
Secondary heating	Room heaters, mains gas	_	
Hot water	From main system	★★★ ☆	★★★☆
Lighting	Low energy lighting in 14% of fixed outlets	★★☆☆☆	★★☆☆☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 2.1 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.9 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

1F3 , 18 DEAN PARK STREET, EDINBURGH, EH4 1JP 19 January 2015 RRN: 2015-5029-7000-0715-0996

Estimated energy of	osts for this home		
	Current energy costs	Potential energy costs	Potential future savings
Heating	£1,149 over 3 years	£678 over 3 years	
Hot water	£303 over 3 years	£267 over 3 years	You could
Lighting	£210 over 3 years	£114 over 3 years	save £603
Total	s £1,662	£1,059	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Po	commended measures	Indicative cost	Typical saving	Rating after	improvement	Green
Re	commended measures	indicative cost	per year	Energy	Environment	Deal
1	Internal or external wall insulation	£4,000 - £14,000	£64	C 75	C 77	
2	Low energy lighting for all fixed outlets	£30	£26	C 76	C 78	
3	Replace boiler with new condensing boiler	£2,200 - £3,000	£45	C 78	B 81	
4	Replace single glazed windows with low-E double glazed windows	£3,300 - £6,500	£64	B 81	B 85	

Measures which have a green deal tick \bigcirc are likely to be eligible for Green Deal finance plans based on indicative costs. Subsidy also may be available for some measures, such as solid wall insulation. Additional support may also be available for certain households in receipt of means tested benefits. Measures which have an orange tick \bigcirc may need additional finance. To find out how you could use Green Deal finance to improve your property, visit www.greenerscotland.org or contact the Home Energy Scotland hotline on 0808 808 2282.

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide longlasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that planning permission might be required and that building regulations apply to this work so it is best to check with your local authority whether a building warrant or planning permission will be required.

2 Low energy lighting

Replacement of traditional light bulbs with energy saving recommended ones will reduce lighting costs over the lifetime of the bulb, and they last up to 12 times longer than ordinary light bulbs. Also consider selecting low energy light fittings when redecorating; contact the Lighting Association for your nearest stockist of Domestic Energy Efficient Lighting Scheme fittings.

3 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to obtain advice from your local authority building standards department and from a qualified heating engineer.

4 Double glazed windows

Double glazing is the term given to a system where two panes of glass are made up into a sealed unit. Replacing existing single-glazed windows with double-glazed windows will improve comfort in the home by reducing draughts and cold spots near windows. Double-glazed windows may also reduce noise, improve security and combat problems with condensation. Building regulations apply to this work and planning permission may also be required, so it is best to check with your local authority on what standards need to be met. A building warrant is not required if the windows comply with the current requirements.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to www.energysavingtrust.org.uk/scotland/rhi.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	3,984	N/A	N/A	(1,062)
Water heating (kWh per year)	1,781			

1F3 , 18 DEAN PARK STREET, EDINBURGH, EH4 1JP 19 January 2015 RRN: 2015-5029-7000-0715-0996

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Allan Scott
Assessor membership number:	EES/009393
Company name/trading name:	D M Hall Chartered Surveyors LLP
Address:	17 Corstorphine Road
	Edinburgh
	EH12 6ĎD
Phone number:	0131 624 6600
Email address:	allan.scott@dmhall.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

This Certificate and Recommendations Report will be available to view online by any party with access to the report reference number (RRN) and to organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK Governments. If you are the current owner or occupier of this building and do not wish this data to be used by these organisations to contact you in relation to such initiatives, please opt out by visiting www.scottishepcregister.org.uk and your data will be restricted accordingly. Further information on this and on Energy Performance Certificates in general can be found at www.scotland.gov.uk/epc.

Opportunity to benefit from a Green Deal on this property

Under a Green Deal, the cost of the improvements is repaid over time via a credit agreement. Repayments are made through a charge added to the electricity bill for the property.

To see which improvements are recommended for this property, please turn to page 3. You can choose which improvements you want to install and ask for a quote from an authorised Green Deal provider. They will organise installation by an authorised Green Deal installer. If you move home, the responsibility for paying the Green Deal charge under the credit agreement passes to the new electricity bill payer.

For householders in receipt of income-related benefits, additional help may be available.

To find out more, visit www.greenerscotland.org or call 0808 808 2282.





chartered surveyors



survey report on:

Property address	1F3 18 DEAN PARK STREET EDINBURGH EH4 1JP
------------------	--

Customer	R Kelliher

Customer address		

Prepared by DM Hall

Date of inspection	14th January 2015
--------------------	-------------------

DM HALL

chartered surveyors

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report² will be from information contained in the Report and the generic Mortgage Valuation Report.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1. <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2. <u>Category 2:</u> Repairs or replacement requiring future attention, but estimates are still advised.
- 3. <u>Category 1:</u> No immediate action or repair is needed.

WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise the southmost first floor flat in a four storey block having three flats per floor. Access by way of common stair. There is no passenger lift.

Accommodation	On the first floor: Entrance hallway, livingroom, kitchen/diningroom, bedroom and bathroom containing fitted suite.
---------------	---

Gross internal floor area (m²)	Approximately 55 square metres
--------------------------------	--------------------------------

Neighbourhood and location	Dean Park Street is located in a central northern district of the City of Edinburgh in an established residential area where several
	surrounding properties are similar in both age and character. Conveniently located for local transport, shopping and educational
	facilities.

Age	In excess of 120 years	
Weather	Overcast and raining during high winds.	

Chimney stacks	Visually inspected with the aid of binoculars where appropriate.
	Stone chimney stacks with pointed stone finish or cement render finishes and lead flashings.

Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.
	Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.
	Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.

If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.
The roof is of a pitched design assumed to be of timber truss construction overlaid with slates with we assume a flat felt clad platform to the mid section. The roof hatch is located off the common stair.

Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	Gutters and downpipes are in cast iron, gutters are of a half round design.

Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The main external walls are traditional 700mm solid stone pointed externally.

Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	Windows are original timber casement type fitted with single glazed units. The main entrance door to the property is timber framed and panelled.

External decorations Vi	isually inspected.
Ex	xternal timbers and gutters and downpipes are painted.

Conservatories / porches	None
Communal areas	Circulation areas visually inspected.
	There is a common stair with bare stone treads leading to all floors.
	There is no passenger lift.
[

Garages and permanent outbuildings	None.

Outside areas and boundaries	Visually inspected.
	Common garden ground to the rear bounded by metal fencing and adjacent property.
Ceilings	Visually inspected from floor level.
	The ceilings are constructed in lath and plaster or plasterboard.

Internal walls	Visually inspected from floor level. Using a moisture meter, walls were randomly tested for
	dampness where considered appropriate. Internal partitions appear to be of solid brick plastered on the hard or a plasterboard finish.


Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.
	Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.
	Flooring is thought to be of suspended timber joists overlaid with tongue and groove boarding. There was no access to the sub-floor area.

Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	Internal joinery finishes are all of timber. Skirtings, doors and door frames date from the time of construction. Kitchen fittings extend to a modern range of floor and wall mounted units.

Chimney breasts and fireplaces	Visually inspected.
	No testing of the flues or fittings was carried out.
	There is a gas fire fitted to other livingroom fireplace. Other fireplaces appear to have been blocked off.

Internal decorations	Visually inspected.
	Wall surfaces have a paint finish.
Cellars	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Mains electricity supply is connected. The fuse board and meter are located to the hall wall. Cabling is of copper and PVC and there are 13 amp power points throughout.
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Mains gas supply is connected. The gas meter is located in the coal cellar.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	Mains water is connected and where seen plumbers piping is of copper and PVC. Sanitary fittings extend to a bath, wash hand basin and wc with electric shower over the bath.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.
	No tests whatsoever were carried out to the system or appliances.
	Heating is supplied from a wall mounted gas fired vokera boiler located within the kitchen and this supplies steel panel radiators and domestic hot water.
Drainage	Drainage covers etc. were not lifted.
	Neither drains nor drainage systems were tested.
	Drainage is to the main sewer.

Fire, smoke and burglar alarms	Visually inspected.
	No tests whatsoever were carried out to the system or appliances.
	Smoke detectors are evident. No evidence of fire or burglar alarm.
Any additional limits to inspection	For flats / maisonettes
Any additional limits to inspection	 For hats / maisonettes Only the subject flat and internal communal areas giving access to the flat were inspected. If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation. The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.
	Internally the inspection was restricted due to the property being fully furnished and having floors covered. No access available below bath, showers or other sanitary fittings. No access available to the roof void due to the height of the hatch above the surveyor's ladder. Externally the inspection was carried out from ground level to the front and rear. I have not carried out an inspection for Japanese Knotweed and unless otherwise stated for the purposes of this report I have assumed that there is no Japanese Knotweed within the boundaries of the property or in neighbouring properties.

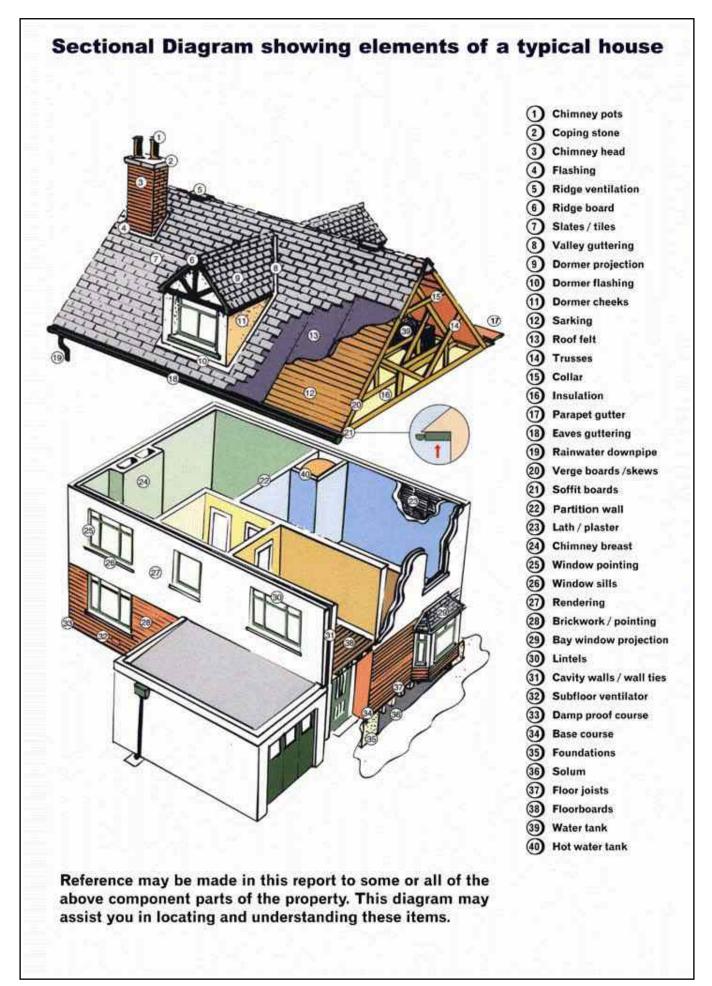

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
	Repairs or replacement requiring future attention, but estimates are still advised.	

Structural movement	
Repair category	1
Notes	There is evidence of previous movement in the property but within the limitations of my inspection I found no evidence to suggest that the movement appears serious and there are no obvious signs of recent movement having occurred.

Dampness, rot and infestation	
Repair category	1
Notes	No obvious evidence of penetrating damp, timber decay or timber wood boring infestation at the time of inspection.

Chimney stacks	
Repair category	2
Notes	From a ground level inspection the chimney stacks were obscured and it appears that some ongoing maintenance to the pointing and flashings can be anticipated. Further advice can be obtained from a qualified roofing contractor.

Roofing including roof space	
Repair category	2
Notes	Our observations of the roof surfaces were severely restricted due to the height of the building and the proximity of adjacent buildings. Roofs of this type and age do require careful and regular maintenance and it would be prudent to instruct a roofing contractor to inspect and comment thereon. It is assumed that any costs for repair would be shared equitably with the co- proprietors.

Rainwater fittings	
Repair category	2
Notes	Rusting gutters and downpipes noted to the front and rear of the property with vegetation growth noted to the front elevation.

Main walls	
Repair category	1
Notes	Generally stone work to front and rear is in order consistent with age.

Windows, external doors and joinery	
Repair category	2
Notes	Wear and tear noted to the mastic pointing and window cills to the front and rear and rear of the property. External doors are in order consistent with age. Common stair doors would benefit from further upgrading.

External decorations	
Repair category	2
Notes	Weathering of woodwork and gutters and downpipes is evident.

Conservatories/porches	
Repair category	-
Notes	None.

Communal areas	
Repair category	1
Notes	No obvious evidence of significant defect readily apparent.

Garages and permanent outbuildings	
Repair category	-
Notes	None.

Outside areas and boundaries	
Repair category	1
Notes	Wear and tear noted.

Ceilings	
Repair category	1
Notes	The ceilings are in order commensurate with age.

Internal walls	
Repair category	1
Notes	Internal walls are to the naked eye relatively plumb with no significant distortion noted.

Floors including sub-floors	
Repair category	1
Notes	Floors are generally level with no significant slopage evident.

Internal joinery and kitchen fittings	
Repair category	1
Notes	Modern kitchen units are fitted and these to be consistent with age and type. Internal joinery has been well maintained.

Chimney breasts and fireplaces	
Repair category	1
Notes	The main fireplace is fitted with a gas fire. Other fireplaces have been blocked off.

Internal decorations	
Repair category	1
Notes	These appear to have recently been refreshed.

Cellars	
Repair category	-
Notes	None

Electricity	
Repair category	1
Notes	There are no obvious signs to suggest the circuitry is not presently functioning satisfactorily. It is prudent, however, to obtain regular information and advice and testing from a qualified NICEIC registered contractor.

Gas	
Repair category	1
Notes	Gas is fitted to the property and it is assumed all fittings were installed in accordance with legislation in place at the time.

Water, plumbing and bathroom fittings	
Repair category	1
Notes	Bathroom fittings appear to be modern and seemed to function satisfactorily. Mastic has been well maintained. No evidence of fracture or leakage noted. No access available below the bath or other sanitary fittings.

Heating and hot water	
Repair category	1
Notes	Wall mounted gas fired boiler which we assume is inspected on an annual basis under a maintenance contract. This practice should be continued. The boiler was not in operation at the time of inspection.

Drainage	
Repair category	1
Notes	No obvious evidence of either chokage or leakage.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	2
Main walls	1
Windows, external doors and joinery	2
External decorations	2
Conservatories/porches	-
Communal areas	1
Garages and permanent outbuildings	-
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	First floor	
2. Are there three steps or fewer to a main entrance door of the property?	Yes No X	
3. Is there a lift to the main entrance door of the property?	Yes No X	
4. Are all door openings greater than 750mm?	Yes No X	
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No	
6. Is there a toilet on the same level as a bedroom?	Yes X No	
7. Are all rooms on the same level with no internal steps or stairs?	Yes X No	
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No	

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

It is thought likely that the liability for common repairs would be shared equitably. Details of any service agreements should be obtained.

It is understood the property is in Band C in relation to the Council Tax.

Estimated reinstatement cost for insurance purposes

It is recommended that the property be insured on a reinstatement basis for a figure not less than £190,000 - ONE HUNDRED AND NINETY THOUSAND POUNDS.

Valuation and market comments

In my opinion the current market value of the above property in its present condition would be fairly stated in the sum of £180,000 - ONE HUNDRED AND EIGHTY THOUSAND POUNDS.

The property market shows early signs of recovery with average selling times reducing from last year and in some cases closing dates being experienced with competitive offers being received.

Signed	Security Print Code [390693 = 7568] Electronically signed
Report author	Allan N M Scott
Company name	DM Hall
Address	17 Corstorphine Road, Edinburgh, EH12 6DD
Date of report	19th January 2015

DM HALL

chartered surveyors

Property Address			
Address Seller's Name Date of Inspection	1F3, 18 DEAN PARK STREET, EDINBURGH, EH4 1JP R Kelliher 14th January 2015		
Property Details			
Property Type	House Bungalow Purpose built maisonette Converted maisonette X Purpose built flat Converted flat Tenement flat Flat over non-residential use Other (specify in General Remarks)		
Property Style	Detached Semi detached Mid terrace End terrace Back to back High rise block X Low rise block Other (specify in General Remarks)		
Does the surveyor be e.g. local authority, m	elieve that the property was built for the public sector, Yes X No hilitary, police?		
Flats/Maisonettes onl	IV Floor(s) on which located First No. of floors in block 4 Lift provided? Yes X No No. of units in block 12 12		
Approximate Year of			
Tenure			
X Absolute Ownership	Leasehold Ground rent £ Unexpired years		
Accommodation			
Number of Rooms	1 Living room(s) 1 Bedroom(s) 1 Kitchen(s) 1 Bathroom(s) 1 WC(s) 0 Other (Specify in General remarks)		
	cluding garages and outbuildings) 55 m² (Internal) 60 m² (External)		
Residential Element ((greater than 40%) X Yes No		
Garage / Parking /	Outbuildings		
Single garage Available on site?	Double garage Parking space X No garage / garage space / parking space Yes No		
Permanent outbuildings:			

Mortgage Valuation Report

Construction							
Walls	Brick	X Stone	Concrete	Timber frame	Othe	r (specify in Gen	eral Remarks)
Roof	Tile	X Slate	Asphalt	Felt	Othe	r (specify in Gen	eral Remarks)
Special Risks							
Has the property s	suffered strue	ctural moveme	ent?			X Yes	No
If Yes, is this recent or progressive?			X No				
Is there evidence, immediate vicinity	•	eason to antic	ipate subsidence	, heave, landslip (or flood in the	e Yes	X No
If Yes to any of the	e above, pro	vide details in	General Remark	ïS.			
Service Connec	tions						
Based on visual ir of the supply in G			ices appear to be	e non-mains, plea	se comment	on the type a	nd location
Drainage	X Mains	Private	None	Water	X Mains	Private	None
Electricity	X Mains	Private	None	Gas	X Mains	Private	None
Central Heating	X Yes	Partial	None				
Brief description c	of Central He	ating:					
Wall mounted ga	as fired comb	i boiler servin	g panel radiators				
Site							
		wifi o al la su the o				in Oanaral D	
Apparent legal iss		ives / access		amenities on separate			
Ill-defined boundar			tural land included wi			red service conn er (specify in Gei	
Location							
Residential suburb	XR	esidential within to	own / city Mixe	ed residential / comme	ercial Mair	nly commercial	
Commuter village		emote village		ated rural property		er (specify in Ger	neral Remarks)
Planning Issues	5						
Has the property I	peen extende	ed / converted	/ altered?	Yes X No			
If Yes provide det	ails in Gener	al Remarks.					
Roads							
X Made up road	Unmade roa	ad Partly	completed new road	Pedestrian a	access only	Adopted	Unadopted

Mortgage Valuation Report

General Remarks

Ongoing general maintenance and repairs to the exterior fabric can be anticipated paying particular attention to all external elements. Some upgrading to wiring circuitry may be required.

There is evidence of previous movement in the property but within the limitations of my inspection I found no evidence to suggest that the movement appears serious and there are no obvious signs of recent movement having occurred.

Essential Repairs

None noted within the limitations of inspection.

Estimated cost of essential repairs £ [

Retention recommended? Yes No

No Amount £

Mortgage Valuation Report

Comment on Mortgageability

The property forms suitable security for loan purposes in present order.

Valuations	
Market value in present condition	£ 180,000
Market value on completion of essential repairs	£ -
Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)	£ 190,000
Is a reinspection necessary?	Yes X No
Buy To Let Cases	
What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis?	£ 750-800
Is the property in an area where there is a steady demand for rented accommodation of this type?	X Yes No

Declaration	
Signed	Security Print Code [390693 = 7568] Electronically signed by:-
Surveyor's name	Allan N M Scott
Professional qualifications	MRICS
Company name	DM Hall
Address	17 Corstorphine Road, Edinburgh, EH12 6DD
Telephone	0131 624 6600
Fax	0131 624 6600
Report date	19th January 2015



chartered surveyors

Property Questionnaire



Property address	Flat 1F3
	18 Dean Park Street
	Edinburgh
	EH4 1JP

questionnaire

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1	Length of ownership					
	How long have you owned the property? 8.5 years (July 2006)					
2	Council tax					
	Which Council Tax band is your property in? (Please tick one) A B CX D E F G H					
3	Parking					
	What are the arrangements for parking at your property? (Please tick all that apply)					
	Garage					
	Allocated parking space					
	Driveway					
	Shared parking					
	On street X					
	Resident permit X					
	Metered parking					
	Other (please specify):					
4	Conservation area					
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	Yes No X Don't know				

5	Listed buildings			
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	Yes No X		
6	Alterations/additions/extensions			
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	Yes No X		
	<u>If you have answered yes</u> , please describe below the changes which you have made: en suite build			
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	Yes No		
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.			
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:			
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?	Yes No X		
	If you have answered yes, please answer the three questions below:			
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes No		
	(ii) Did this work involve any changes to the window or door openings?	Yes No		
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):			
	Please give any guarantees which you received for this work to your solicitor or est agent.			

7	Central heating	
а.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom). <u>If you have answered yes or partial</u> – what kind of central heating is there? Gas fired - Combi boiler (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). <u>If you have answered yes</u> , please answer the three questions below: (i)When was your central heating system or partial central heating system	Partial
	 (i)Do you have a maintenance contract for the central heating system? If you have answered yes, please give details of the company with which you have a maintenance contract: (i)When was your maintenance agreement last renewed? (Please prov year). 	Yes No X
8	Energy Performance Certificate Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes X No
9	Issues that may have affected your property	
а.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	Yes No X
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	Yes No
b.	Are you aware of the existence of asbestos in your property? If you have answered yes, please give details:	Yes No X

10	Services	
Servio Gas or Water Electri Mains Teleph	r liquid petroleum gas X Scottish Power mains or private water supply X Council icity X Scottish Power drainage none TV or satellite	s of the supplier:
Diodal		
b.	Is there a septic tank system at your property? If you have answered yes, please answer the two questions below: (i)Do you have appropriate consents for the discharge from your septic tank?	Yes No X Yes No Don't Know
	(i)Do you have a maintenance contract for your septic tank? <u>If you have answered yes</u> , please give details of the company with which you have a maintenance contract:	Yes No

11	Responsibilities for shared or common areas	
а.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:	Yes No X Don't Know
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details: Costs of roof repairs shared between all owners (12 flats in buliding)	Yes X No Not applicable
c.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	Yes No X
d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries? <u>If you have answered yes</u> , please give details:	Yes No X
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	Yes No X
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.) If you have answered yes, please give details:	Yes No X Don't Know
12	Charges associated with your property	
а.	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges: Edinburgh Council	Yes X No

b.	Is there a common buildings insurance policy?	Yes No X	
		Don't Know	
	If you have answered yes, is the cost of the insurance included in	Yes	
	your monthly/annual factor's charges?	No	
		Don't Know	
с.	Please give details of any other charges you have to pay on a regular upkeep of common areas or repair works, for example to a residents' maintenance or stair fund. (Not sure of this as property has been rent	association, or	
13	Specialist works		
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or	Yes	
	any other specialist work ever been carried out to your property?	No X	
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.		
b.	As far as you are aware, has any preventative work for dry rot, wet	Yes	
	rot, or damp ever been carried out to your property?	No X	
	If you have answered yes, please give details:		
с.	If you have answered yes to 13(a) or (b), do you have any	Yes	
	guarantees relating to this work?	No	
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write below</u> who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.		
	Guarantees are held by:		

14	Guarantees					
a.	Are there any guarantees or warranties for any of the following:					
		No	Yes	Don't know	With title deeds	Lost
(i)	Electrical work	X				
(ii)	Roofing	X				
(iii)	Central heating	X				
(iv)	National House Building Council (NHBC)	X				
(v)	Damp course	X				
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	X				
b.	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):					
с.	Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details:			Yes No		
15	5 Boundaries					
	So far as you are aware, has any boundary of your property been moved in the last 10 years?			Yes No X		
	If you have answered yes, please give details:			Don't know		

16	Notices that affect your property				
	In the past three years have you ever received a notice:				
a.	advising that the owner of a neighbouring property has made a planning application?	Yes No X			
b.	that affects your property in some other way?	Yes No X			
c. that requires you to do any maintenance, repairs or improte to your property?		Yes No X			
	If you have answered yes to any of $a-c$ above, please give the notices to your solici estate agent, including any notices which arrive at any time before the date of entry the purchaser of your property.				

Declaration by the seller(s)/or other authorised body or person(s)

I confirm that the information in this form is true and correct to the best of my knowledge and belief.

Signature(s) : Ruth Kelliher_____

Date: 18/1/15_____

DM Hall Offices

Aberdeen 01224 594172

Ayr 01292 286974

Cumbernauld 01236 618900

Cupar 01334 844826

Dumfries 01387 254318

Dundee 01382 873100

Dunfermline 01383 621262

Edinburgh 0131 477 6000

Elgin 01343 548501 Falkirk 01324 628321

Galashiels 01896 752009

Glasgow (North) 0141 332 8615

Glasgow (South) 0141 636 4141

Hamilton 01698 284939

Inverness 01463 241077

Inverurie 01467 624393

Irvine 01294 311070

Kirkcaldy 01592 598200

Livingston 01506 490404

Musselburgh 0131 665 6782

Oban 01631 564225

Paisley 0141 887 7700

Perth 01738 562100

Peterhead 01779 470220

Stirling 01786 475785

