

espc:home report



3/5 Mertoun Place
EDINBURGH
EH11 1JU
28/09/2018

Home Report Index

1. Single Survey
2. Energy Report
3. Property Questionnaire

Single Survey

survey report on:

Property address	3F1, 3 Mertoun Place, Edinburgh, EH11 1JU
-------------------------	--

Customer	Mr N Rothnie, Mrs E Rothnie
-----------------	-----------------------------

Customer address	Neil Rothnie Architects, 73 Huntly Street, ABERDEEN, AB10 1TE
-------------------------	--

Prepared by	Harvey Donaldson And Gibson
--------------------	-----------------------------

Date of inspection	27th September 2018
---------------------------	---------------------



HARVEY
DONALDSON
& GIBSON
CHARTERED SURVEYORS

Parent to HomeReportScotland.scot

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The ultimate holding company of Harvey Donaldson & Gibson is Countrywide plc. In Scotland, Countrywide plc also own Slater Hogg & Howison and Countrywide North. A full list of estate agents owned or under franchise to Countrywide plc is available on request. Harvey Donaldson & Gibson trades as an entirely separate company and has no financial interest whatsoever in the disposal of the property being inspected.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

Terms and Conditions

Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information

Terms and Conditions

contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

Terms and Conditions

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be

researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

Terms and Conditions

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated.* This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a purpose-built third/top floor flat within a traditional four storey tenement. Access is via a shared ground floor entrance and internal stair.
Accommodation	Third/top floor: Entrance hall, lounge, kitchen, three bedrooms, bathroom and storage.
Gross internal floor area (m²)	75m ² or thereby.
Neighbourhood and location	<p>The subjects are situated to the south-west of Edinburgh City centre within the Polwarth District of the City in an area where surrounding properties are generally similar in both age and character.</p> <p>Local shopping, transport and education facilities can be found close by.</p>
Age	The subjects were originally constructed circa 1900.
Weather	At the time of inspection weather conditions were overcast following a period of mixed weather.
Chimney stacks	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>The chimneys are a combination of stone and rendered masonry construction with flashing formed in lead and cement mortar.</p>

<p>Roofing including roof space</p>	<p>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</p> <p>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</p> <p>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>The roof is a combination of pitched and flat design. Pitched surfaces have a natural slate cladding with the flat section assumed to have a mineral felt or similar covering.</p> <p>Access to the common roof space area is via a hatch located on the top floor landing.</p>
<p>Rainwater fittings</p>	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>The rainwater fittings are run in cast-iron materials.</p>
<p>Main walls</p>	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>The main external walls are of traditional stone construction.</p>
<p>Windows, external doors and joinery</p>	<p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p> <p>Windows are of replacement uPVC framed units containing double glazing.</p> <p>The entrance door is of timber design.</p>
<p>External decorations</p>	<p>Visually inspected.</p> <p>External decorations are of mixed design and paint finished in parts.</p>
<p>Conservatories / porches</p>	<p>Not applicable.</p>
<p>Communal areas</p>	<p>Circulation areas visually inspected.</p> <p>Access to the property is via a shared ground floor entrance and internal stair.</p>


Garages and permanent outbuildings	Not applicable.
Outside areas and boundaries	<p>Visually inspected.</p> <p>The property would appear to have access to a communal garden to the rear. Boundaries are formed in masonry walls and metal fencing.</p>
Ceilings	<p>Visually inspected from floor level.</p> <p>Ceilings are a combination of lath and plaster and plasterboard.</p>
Internal walls	<p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p> <p>Internal walls and partitions are a combination of brickwork or similar and timber stud design with plaster finishes.</p>
Floors including sub floors	<p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p> <p>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</p> <p>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p> <p>Flooring is of suspended timber design.</p>
Internal joinery and kitchen fittings	<p>Built-in cupboards were looked into but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p> <p>Internal joinery is of mixed design comprising timber sections which are paint finished.</p> <p>The kitchen provides an adequate amount of wall and floor mounted units with worktop surfaces.</p>
Chimney breasts and fireplaces	<p>Visually inspected.</p> <p>No testing of the flues or fittings was carried out.</p> <p>There is a gas fire in the lounge although this was not tested at the time of inspection.</p> <p>Other fireplaces have been blocked up in the past.</p>

Single Survey

Internal decorations	Visually inspected. Internal decorations are based on paint and paper finishes.
Cellars	Not applicable.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Mains electricity is connected with power points located throughout the property. The electrical switch gear is located within the entrance hall.
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Gas is supplied from the mains.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances. Where visible, plumbing/pipework was run in copper and plastic materials. The bathroom provides bath with shower facility, sink and toilet.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances. Central heating is by way of a gas fired boiler serving panel radiators located throughout the property. Domestic hot water is supplied on a direct demand basis via the central heating system.
Drainage	Drainage covers etc were not lifted. Neither drains nor drainage systems were tested. The property is connected to mains drainage.

Fire, smoke and burglar alarms	Visually inspected. No tests whatsoever were carried out to the system or appliances. Smoke detection devices were noted although not tested at the time of inspection.
Any additional limits to inspection	For flats / maisonettes Only the subject flat and internal communal areas giving access to the flat were inspected. If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation. The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance. The property was inspected within the limits imposed. At the time of inspection the property was fully furnished with floor coverings fitted. Items were not removed from cupboards. This report does not constitute a full and detailed description of the property and a structural investigation was not carried out. No inspection was undertaken of woodwork or other parts of the structure which are covered, unexposed or otherwise inaccessible and as a result no guarantee can be given that such parts of the structure are free from rot, beetle or other defects. No removal of internal linings has been carried out in order to ascertain the condition of hidden parts and no warranty can be given regarding the areas not specifically referred to in this report. Where walls are lined internally, for example with plasterboard, tiling or timber, the structure behind the lining could not be tested with an electronic moisture meter. No access was gained to any sub-floor area within the building. The inspection of the common roof space was carried out from adjacent to the hatch and was restricted due to stored items and laid insulation. The external building fabric has been inspected from ground level only from the subjects grounds and where possible from adjoining public property. Exposure work has not been carried out. No access was gained to the rear of the building.

Sectional Diagram showing elements of a typical house

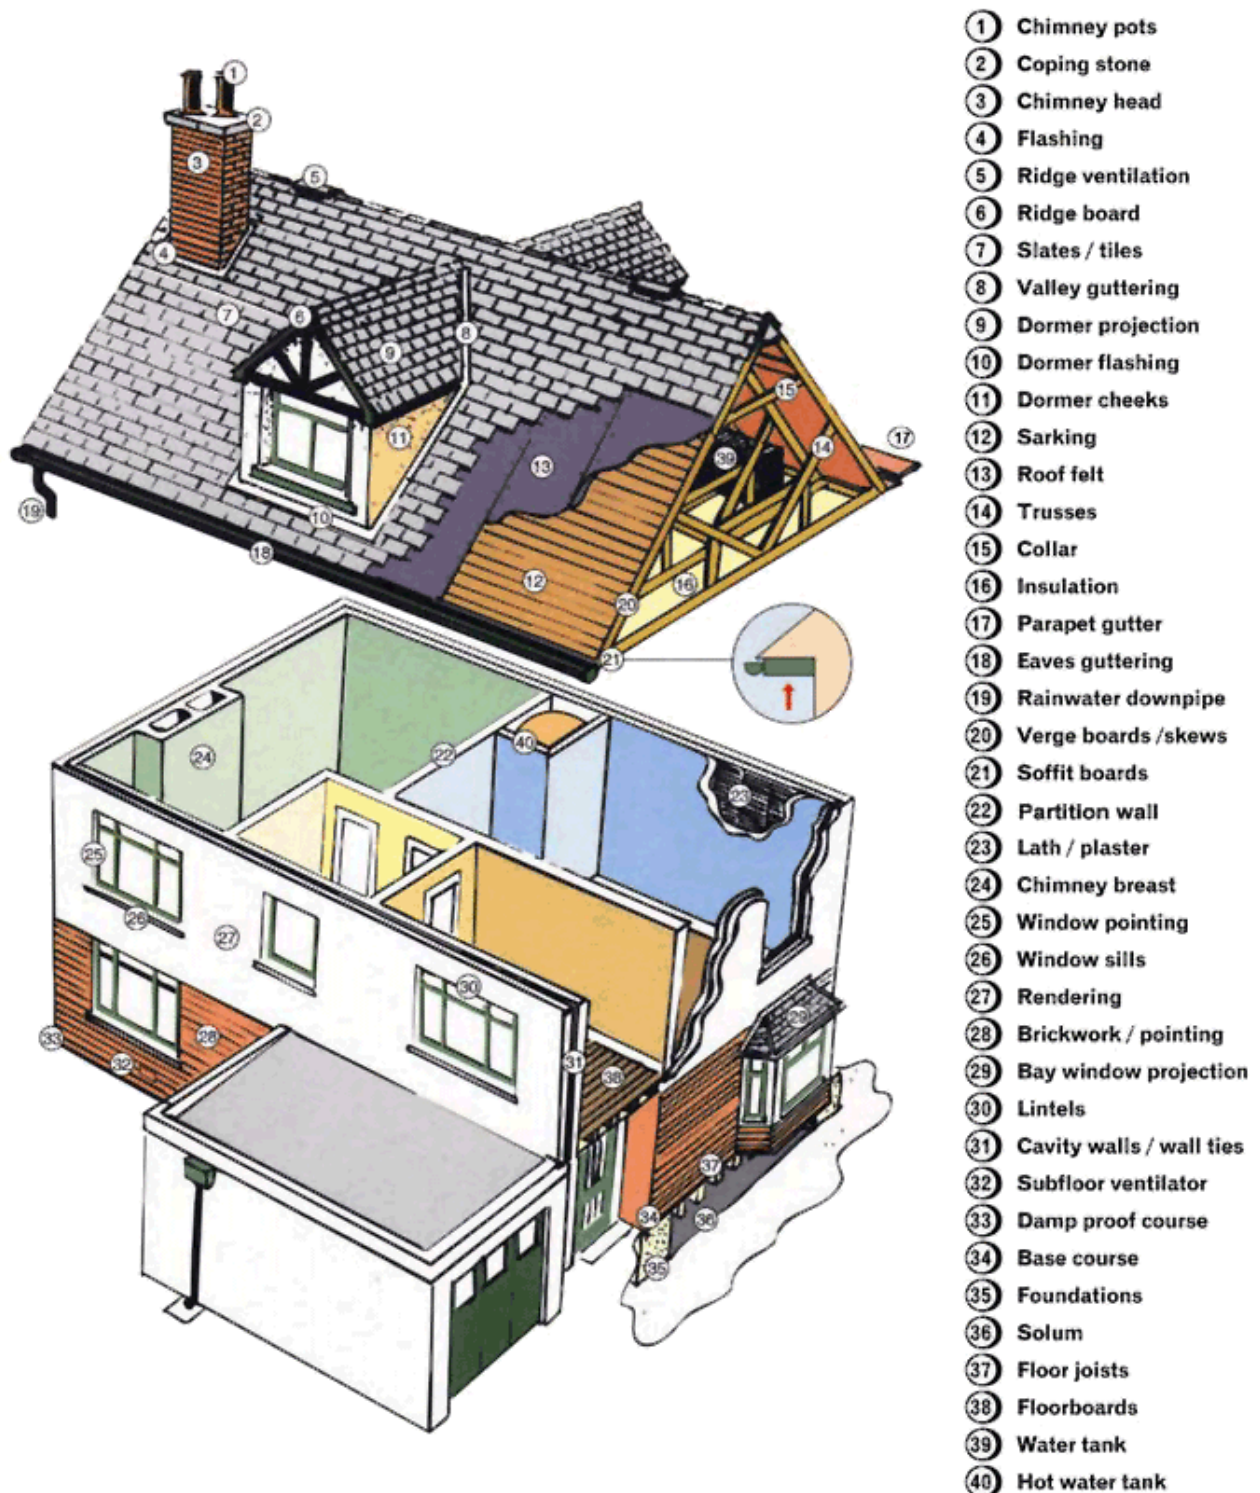


- ① Chimney pots
- ② Coping stone
- ③ Chimney head
- ④ Flashing
- ⑤ Ridge ventilation
- ⑥ Ridge board
- ⑦ Slates / tiles
- ⑧ Valley guttering
- ⑨ Dormer projection
- ⑩ Dormer flashing
- ⑪ Dormer cheeks
- ⑫ Sarking
- ⑬ Roof felt
- ⑭ Trusses
- ⑮ Collar
- ⑯ Insulation
- ⑰ Parapet gutter
- ⑱ Eaves guttering
- ⑲ Rainwater downpipe
- ⑳ Verge boards /skews
- ㉑ Soffit boards
- ㉒ Partition wall
- ㉓ Lath / plaster
- ㉔ Chimney breast
- ㉕ Window pointing
- ㉖ Window sills
- ㉗ Rendering
- ㉘ Brickwork / pointing
- ㉙ Bay window projection
- ㉚ Lintels
- ㉛ Cavity walls / wall ties
- ㉜ Subfloor ventilator
- ㉝ Damp proof course
- ㉞ Base course
- ㉟ Foundations
- ㊱ Solum
- ㊲ Floor joists
- ㊳ Floorboards
- ㊴ Water tank
- ㊵ Hot water tank


Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

 Structural movement	
Repair category	1
Notes	There is evidence of previous movement in the form of disturbance to external masonry, internal plaster cracking and internal floors/joinery finishes running off level. The movement is considered to be longstanding in nature with no indication of recent structural deterioration. On the basis of a limited single inspection, no further significant movement is anticipated.

 Dampness, rot and infestation	
Repair category	2
Notes	<p>Random testing, where accessible, was carried out with an electronic moisture meter throughout the property.</p> <p>Damp readings were recorded to flooring in the bathroom. Reference should be made to the comments below.</p>

 Chimney stacks	
Repair category	2
Notes	<p>Evidence of weathering/deterioration was noted to masonry finishes.</p> <p>Flashings are formed in cement, which is an inferior material with a limited life expectancy.</p>



Roofing including roof space

Repair category	2
Notes	<p>The inspection of roof coverings was restricted from street level. Slipped and damaged slates were noted. Ridge detailing has also slipped/lifted in parts.</p> <p>The flat roof section was not visible. Flat roof coverings have a limited life, and ongoing repairs and periodic replacement must be anticipated.</p> <p>Past leakage was noted at the sky light within the common stair. Flashing details are also poorly finished.</p> <p>Within the roof space area, evidence of past leakage/staining was noted to timbers generally consistent with age. 'Daylight' was also visible in parts. It would appear the roof does not have the benefit of an under-slate felt. In the absence of complete stripping and re-covering, this roof structure will be an increasingly frequent source of maintenance expenditure.</p>



Rainwater fittings

Repair category	2
Notes	Evidence of weathering/corrosion and vegetation growth was noted.



Main walls

Repair category	1
Notes	The sandstone is weathered and eroded in places but this is considered commensurate with the age and type of property inspected.




Windows, external doors and joinery


Repair category	2
Notes	The windows are of an older replacement type and generally in a condition consistent with age, although some repair and adjustment should be anticipated.





External decorations


Repair category	1
Notes	The external decorations are mostly in reasonable condition but are beginning to deteriorate in places.


 Conservatories/porches	
Repair category	-
Notes	Not applicable.

 Communal areas	
Repair category	1
Notes	The shared ground floor entrance and internal stair are generally in a condition consistent with age, although some repairs are required.

 Garages and permanent outbuildings	
Repair category	-
Notes	Not applicable.

 Outside areas and boundaries	
Repair category	1
Notes	No direct access was gained to the garden to the rear. The garden was inspected from the subject property. The gardens would appear to be in fair order.

 Ceilings	
Repair category	1
Notes	The ceilings appeared reasonably sound allowing for age.

 Internal walls	
Repair category	1
Notes	The internal walls are in reasonable condition for their age.



Floors including sub-floors

Repair category	2
Notes	<p>Where visible floors were generally satisfactory allowing for age and normal wear.</p> <p>Damp readings were recorded to flooring in the bathroom, with the tile covering noted to be damaged and loose underfoot. This can be indicative of underlying defects, although it will be appreciated no inspection of underlying areas was possible.</p>



Internal joinery and kitchen fittings

Repair category	1
Notes	<p>Internal joinery is of mixed design and vintage, and although worn in some areas, appears generally serviceable. Timberwork, door ironmongery, etc have all suffered wear and deterioration, consistent with age.</p> <p>The kitchen fittings are displaying signs of wear and tear.</p>



Chimney breasts and fireplaces

Repair category	1
Notes	<p>There is a gas fire in the lounge although this was not tested at the time of inspection.</p> <p>Other fireplaces have been blocked up in the past, but not ventilated. Although no dampness was noted all disused flues should be vented at the fireplace and at the chimney head.</p>



Internal decorations

Repair category	1
Notes	The internal decorations are satisfactory.



Cellars

Repair category	-
Notes	Not applicable.



Electricity

Repair category	1
Notes	<p>The system would appear to be of mixed design. There is a notice on the switch gear recommending the system is next tested/inspected by September 2019. Copies of all associated documentation relating to the system should be obtained prior to purchase.</p> <p>It is recommended good practice that all electrical installations should be checked periodically, approximately every ten years or when a property changes hands. This should be regarded as a routine safety and maintenance check.</p>



Gas

Repair category	1
Notes	<p>The gas installation appears to be generally commensurate with the age of the installation. The gas meter and supply should be checked on an annual basis.</p>



Water, plumbing and bathroom fittings

Repair category	2
Notes	<p>The plumbing installation appeared generally satisfactory commensurate with type and age.</p> <p>Bathroom fittings were beginning to show signs of wear. Past leakage was noted adjacent to the bath. Reference should be made to the comments in 'Floors including sub-floors' above.</p>



Heating and hot water

Repair category	1
Notes	<p>The system was not running at the time of inspection but appeared serviceable.</p> <p>It is recommended good practice that gas boilers are serviced on an annual basis by an appropriately qualified person. The boiler's service history should be checked by referring to the service records. If there is no record of a recent service, the boiler should be checked by an appropriately qualified person.</p>



Drainage

Repair category	1
Notes	<p>No obvious significant defects were noted to the drainage system, within the limitations of the inspection.</p>

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	2
Main walls	1
Windows, external doors and joinery	2
External decorations	1
Conservatories/porches	-
Communal areas	1
Garages and permanent outbuildings	-
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	2
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	2
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Third Floor
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The tenure is understood to be outright ownership. The management and service charge details have not been inspected and it is assumed it does not contain onerous provisions which would adversely affect valuation.

If the legal advisers find that there are significant variations from the standard assumptions then this should be referred back to the surveyor.

The property has been altered internally paying particular attention to the relocation of the kitchen and formation of the bathroom. The valuation is given on the assumption that full certification in respect of the planning permissions, building warrants and completion certificates were issued for these works.

In line with our normal practice, it is specifically assumed that the property and its value are unaffected by any matters which would or should be revealed to a competent Completing Solicitor by a local search and replies to the usual enquiries, or by any statutory notice and planning proposal.

It has been assumed all common repairs to the subject building will be shared amongst the co-proprietors on an equal basis. Checks should be made to establish if any works are being undertaken or are proposed to the block.

The property would appear to have access to a communal garden to the rear. It is always sensible when purchasing any property to find out who owns all outside areas/boundaries and who is responsible for their maintenance. Your legal advisers will obtain this information.

Estimated reinstatement cost for insurance purposes

£215,000 (Two hundred and fifteen thousand pounds sterling).

Valuation and market comments

In its present condition the opinion of valuation for the Outright Ownership interest with vacant possession on the 27th September 2018 is £300,000 (Three hundred thousand pounds sterling).

Signed	Security Print Code [598390 = 6424]O Electronically signed
Report author	Nick Bonnar
Company name	Harvey Donaldson And Gibson

Single Survey

Address	33 Castle Street, Edinburgh, EH2 3DN
----------------	--------------------------------------

Date of report	28th September 2018
-----------------------	---------------------

Mortgage Valuation Report



HARVEY
DONALDSON
& GIBSON
CHARTERED SURVEYORS
Parent to HomeReportScotland.scot

Property Address

Address 3F1, 3 Mertoun Place, Edinburgh, EH11 1JU
Seller's Name Mr N Rothnie, Mrs E Rothnie
Date of Inspection 27th September 2018

Property Details

Property Type House Bungalow Purpose built maisonette Converted maisonette
 Purpose built flat Converted flat Tenement flat Flat over non-residential use
 Other (specify in General Remarks)

Property Style Detached Semi detached Mid terrace End terrace
 Back to back High rise block Low rise block Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police?

Yes No

Flats/Maisonettes only Floor(s) on which located No. of floors in block Lift provided? Yes No
No. of units in block

Approximate Year of Construction

Tenure

Absolute Ownership Leasehold Ground rent £ Unexpired years

Accommodation

Number of Rooms Living room(s) Bedroom(s) Kitchen(s)
 Bathroom(s) WC(s) Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings) m² (Internal) m² (External)

Residential Element (greater than 40%) Yes No

Garage / Parking / Outbuildings

Single garage Double garage Parking space No garage / garage space / parking space
Available on site? Yes No

Permanent outbuildings:

Mortgage Valuation Report

Construction

Walls Brick Stone Concrete Timber frame Other (specify in General Remarks)
Roof Tile Slate Asphalt Felt Other (specify in General Remarks)

Special Risks

Has the property suffered structural movement? Yes No

If Yes, is this recent or progressive? Yes No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? Yes No

If Yes to any of the above, provide details in General Remarks.

Service Connection

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage Mains Private None Water Mains Private None
Electricity Mains Private None Gas Mains Private None
Central Heating Yes Partial None

Brief description of Central Heating:

Full gas system.

Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

Rights of way Shared drives / access Garage or other amenities on separate site Shared service connections
 Ill-defined boundaries Agricultural land included with property Other (specify in General Remarks)

Location

Residential suburb Residential within town / city Mixed residential / commercial Mainly commercial
 Commuter village Remote village Isolated rural property Other (specify in General Remarks)

Planning Issues

Has the property been extended / converted / altered? Yes No

If Yes provide details in General Remarks.

Roads

Made up road Unmade road Partly completed new road Pedestrian access only Adopted Unadopted

Mortgage Valuation Report

General Remarks

The general condition of the property appears consistent with its age and type of construction, but some works of repair and maintenance are required.

There is evidence of previous movement in the form of disturbance to external masonry, internal plaster cracking and internal floors/joinery finishes running off level. The movement is considered to be longstanding in nature with no indication of recent structural deterioration. On the basis of a limited single inspection, no further significant movement is anticipated.

The property has been altered internally paying particular attention to the relocation of the kitchen and formation of the bathroom. The valuation is given on the assumption that full certification in respect of the planning permissions, building warrants and completion certificates were issued for these works.

In line with our normal practice, it is specifically assumed that the property and its value are unaffected by any matters which would or should be revealed to a competent Completing Solicitor by a local search and replies to the usual enquiries, or by any statutory notice and planning proposal.

It has been assumed all common repairs to the subject building will be shared amongst the co-proprietors on an equal basis. Checks should be made to establish if any works are being undertaken or are proposed to the block.

The property would appear to have access to a communal garden to the rear. It is always sensible when purchasing any property to find out who owns all outside areas/boundaries and who is responsible for their maintenance. Your legal advisers will obtain this information.

Essential Repairs

None noted for mortgage purposes.

Estimated cost of essential repairs £ Retention recommended? Yes No Amount £

Mortgage Valuation Report

Comment on Mortgageability

This property forms suitable security for normal lending purposes.

Valuations

Market value in present condition £

Market value on completion of essential repairs £

Insurance reinstatement value £
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

Is a reinspection necessary? Yes No

Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? £

Is the property in an area where there is a steady demand for rented accommodation of this type? Yes No

Declaration

Signed Security Print Code [598390 = 6424]O
Electronically signed by:-
Surveyor's name Nick Bonnar
Professional qualifications MRICS
Company name Harvey Donaldson And Gibson
Address 33 Castle Street, Edinburgh, EH2 3DN
Telephone 0131 225 7668
Fax
Report date 28th September 2018

Energy Performance Certificate (EPC)

Scotland

Dwellings

3F1 , 3 MERTOUN PLACE, EDINBURGH, EH11 1JU

Dwelling type: Top-floor flat
Date of assessment: 27 September 2018
Date of certificate: 27 September 2018
Total floor area: 75 m²
Primary Energy Indicator: 261 kWh/m²/year


Reference number: 9100-7839-0229-3028-1183
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£2,307	See your recommendations report for more information
Over 3 years you could save*	£777	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

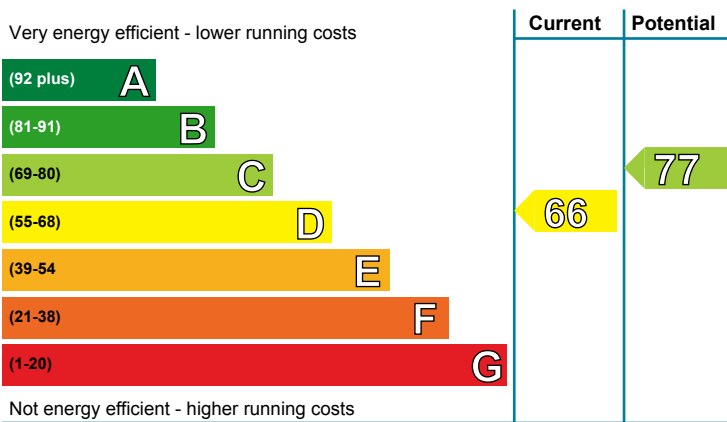


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (66)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

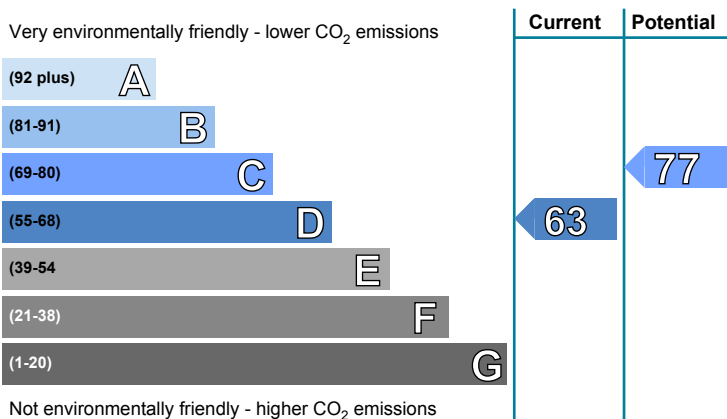

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.


Your current rating is **band D (63)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years	Available with Green Deal
1 Internal or external wall insulation	£4,000 - £14,000	£450.00	✓
2 Low energy lighting	£45	£102.00	
3 Condensing boiler	£2,200 - £3,000	£228.00	✓

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

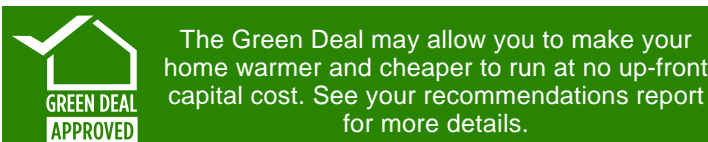

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Solid brick, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, 300 mm loft insulation	★★★★★	★★★★★
Floor	(another dwelling below)	—	—
Windows	Fully double glazed	★★★★☆☆	★★★★☆☆
Main heating	Boiler and radiators, mains gas	★★★★☆☆	★★★★☆☆
Main heating controls	Programmer, TRVs and bypass	★★★★☆☆	★★★★☆☆
Secondary heating	Room heaters, mains gas	—	—
Hot water	From main system	★★★★☆☆	★★★★☆☆
Lighting	Low energy lighting in 25% of fixed outlets	★★★★☆☆	★★★★☆☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 46 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 3.4 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 1.3 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£1,662 over 3 years	£1,071 over 3 years	
Hot water	£348 over 3 years	£288 over 3 years	
Lighting	£297 over 3 years	£171 over 3 years	
Totals	£2,307	£1,530	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement		Green Deal
			Energy	Environment	
1 Internal or external wall insulation	£4,000 - £14,000	£150	C 73	C 72	✔
2 Low energy lighting for all fixed outlets	£45	£34	C 74	C 73	
3 Replace boiler with new condensing boiler	£2,200 - £3,000	£76	C 77	C 77	✔

Measures which have a green deal tick ✔ are likely to be eligible for Green Deal finance plans based on indicative costs. Subsidy also may be available for some measures, such as solid wall insulation. Additional support may also be available for certain households in receipt of means tested benefits. Measures which have an orange tick ✔ may need additional finance. To find out how you could use Green Deal finance to improve your property, visit www.greenerscotland.org or contact the Home Energy Scotland hotline on 0808 808 2282.

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Micro CHP

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

2 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

3 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to www.energysavingtrust.org.uk/scotland/rhi.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	6,105	N/A	N/A	(2,123)
Water heating (kWh per year)	2,055			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Nicholas Bonnar
Assessor membership number:	EES/016081
Company name/trading name:	Harvey Donaldson & Gibson Chartered Surveyors
Address:	8 Manor Place Edinburgh EH3 7DD
Phone number:	01312257668
Email address:	frances.wilson@hdg.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.


Opportunity to benefit from a Green Deal on this property

Under a Green Deal, the cost of the improvements is repaid over time via a credit agreement. Repayments are made through a charge added to the electricity bill for the property.

To see which improvements are recommended for this property, please turn to page 3. You can choose which improvements you want to install and ask for a quote from an authorised Green Deal provider. They will organise installation by an authorised Green Deal installer. If you move home, the responsibility for paying the Green Deal charge under the credit agreement passes to the new electricity bill payer.

For householders in receipt of income-related benefits, additional help may be available.

To find out more, visit www.greenerscotland.org or call 0808 808 2282.

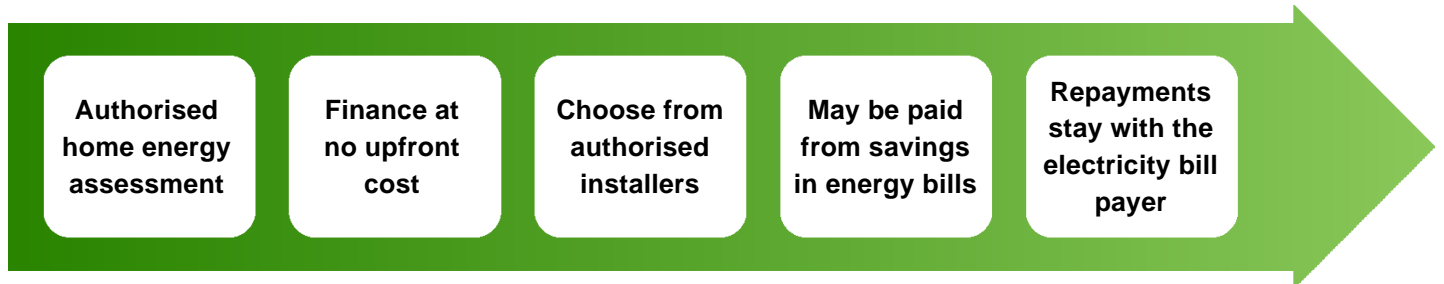

Property Questionnaire

Property Address	3/5 Mertoun Place EDINBURGH EH11 1JU
-------------------------	--

Seller(s)	Mr Neil Rothnie Mrs Elaine Rothnie
------------------	---------------------------------------

Completion date of property questionnaire	21/09/2018
--	------------

1 Length of ownership

How long have you owned the property?

13

2 Council tax

Which Council Tax band is your property in?

C

3 Parking

What are the arrangements for parking at your property?

(Please tick all that apply)

Garage

Allocated parking space

Driveway

Shared parking

On street

Resident permit

Metered parking

Other (please specify)

car club stances available directly in front of flat

4 Conservation area

Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?

No

5 Listed buildings

Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?

No

6 Alterations/additions/extensions

a.(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?

No

If you have answered yes, please describe below the changes which you have made:

(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?

If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.

If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:

b. Have you had replacement windows, doors, patio doors or double glazing installed in your property?

No

If you have answered yes, please answer the three questions below:

- (i) Were the replacements the same shape and type as the ones you replaced?
- (ii) Did this work involve any changes to the window or door openings?
- (iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):

Please give any guarantees which you received for this work to your solicitor or estate agent.

7 Central heating

a. Is there a central heating system in your property?

(Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).

Yes

If you have answered yes or partial — what kind of central heating is there?

(Examples: gas-fired, solid fuel, electric storage heating, gas warm air).

gas fired

If you have answered yes, please answer the three questions below:

(i) When was your central heating system or partial central heating system installed?

prior to purchase of flat

(ii) Do you have a maintenance contract for the central heating system?

No

If you have answered yes, please give details of the company with which you have a maintenance contract:

(iii) When was your maintenance agreement last renewed?

(Please provide the month and year).

8 Energy Performance Certificate

Does your property have an Energy Performance Certificate which is less than 10 years old?

No

9 Issues that may have affected your property

a. Has there been any storm, flood, fire or other structural damage to your property while you have owned it?

No

If you have answered yes, is the damage the subject of any outstanding insurance claim?

b. Are you aware of the existence of asbestos in your property?

No

If you have answered yes, please give details:

10 Services

Please tick which services are connected to your property and give details of the supplier:

Services**Connected Supplier**

Gas or liquid petroleum gas	<input checked="" type="checkbox"/>	npower
Water mains or private water supply	<input checked="" type="checkbox"/>	scottish water
Electricity	<input checked="" type="checkbox"/>	npower
Mains drainage	<input checked="" type="checkbox"/>	City of Edinburgh Council
Telephone	<input type="checkbox"/>	
Cable TV or satellite	<input checked="" type="checkbox"/>	virgin
Broadband	<input type="checkbox"/>	

b. Is there a septic tank system at your property?

No

(i) Do you have appropriate consents for the discharge from your septic tank?

(ii) Do you have a maintenance contract for your septic tank?

If you have answered yes, please give details of the company with which you have a maintenance contract:

11 Responsibilities for shared or common areas

a. Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?

No

If you have answered yes, please give details:

b. Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?

Yes

If you have answered yes, please give details:

roof repairs arranged £392 as contribution

c. Has there been any major repair or replacement of any part of the roof during the time you have owned the property?

No

d. Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?

No

If you have answered yes, please give details:

e. As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?

No

If you have answered yes, please give details:

f. As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)

No

If you have answered yes, please give details:

12 Charges associated with your property

- a. Is there a factor or property manager for your property?

No

- b. Is there a common buildings insurance policy?

No

If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?

- c. Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.

13 Specialist works

- a. As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?

No

If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.

- b. As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?

No

If you have answered yes, please give details:

- c. If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?

If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate., these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.

Guarantees are held by:

14 Guarantees

- a. Are there any guarantees or warranties for any of the following:

- (i) Electrical work

Yes

- (ii) Roofing

No

- (iii) Central heating
No
- (iv) National House Building Council (NHBC)
No
- (v) Damp course
No
- (vi) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)
No
- b. If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):
 - (i) Electrical work
electrical certification of system available [for HMO]
 - (ii) Roofing
 - (iii) Central heating
 - (iv) National House Building Council (NHBC)
 - (v) Damp course
 - (vi) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)
- c. Are there any outstanding claims under any of the guarantees listed above?
No
If you have answered yes, please give details:

15 Boundaries

So far as you are aware, has any boundary of your property been moved in the last 10 years?

No

If you have answered yes, please give details:

16 Notices that affect your property

In the past three years have you ever received a notice:

- a. advising that the owner of a neighbouring property has made a planning application?
No
- b. that affects your property in some other way?
No
- c. that requires you to do any maintenance, repairs or improvements to your property?
No

If you have answered yes to any of a–c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.