



eport Inde Home

Single Survey Energy Report Property Questionnaire

survey report on:


Property address	Flat 1/1, 72 Brown Street, Glasgow, G2 8PD
------------------	---

Customer	Mr T Stodart
----------	--------------

Customer address	Flat 1/1, 72 Brown Street, Glasgow,, G2 8PD
------------------	--

	Prepared by	Harvey Donaldson And Gibson
--	-------------	-----------------------------

Date of inspection 28th Ju	ly 2017
----------------------------	---------

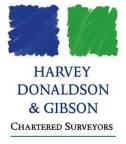

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The ultimate holding company of Harvey Donaldson & Gibson is Countrywide plc. In Scotland, Countrywide plc also own Slater Hogg & Howison and Countrywide North. A full list of estate agents owned or under franchise to Countrywide plc is available on request. Harvey Donaldson & Gibson trades as an entirely separate company and has no financial interest whatsoever in the disposal of the property being inspected.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

Х

Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information

contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

Terms and Conditions

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be

researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a purpose-built, first floor flat in a four storey
	block which contains twelve flats. The building has a basement garage and we have been advised the property has one designated parking space.

Accommod	ation	First Floor: Entrance hall, living room, kitchen, bedroom and
		internal bathroom.

Gross internal floor area (m²)	51 m2

Neighbourhood and location	The property is situated in an area of mixed residential and commercial use in central Glasgow. Surrounding properties are of mixed type and character. All the usual city centre amenities are available nearby.

Age	27 years.
Weather	It was dry at the time of inspection.
Chimney stacks Not applicable.	

Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.
	Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.
	Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.
	If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.
	The roof is part pitched and covered with man made slates and part flat. The flat roof is covered with a bituminous felt material.

Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	The rainwater fittings are UPVC plastic type.

Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The main walls are cavity construction with facing brick externally. Internally, the walls are lined with plasterboard. The wall thickness is approximately 420mm.

Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	The windows are the original, timber-framed, double glazed, casement units. The entrance door is timber with glazed infill panel. The fascia boards and soffits at the eaves of the roof appeared to be timber.

External decorations	Visually inspected.
	The external joinery is finished with a decorative stain.

Conservatories / porches	Not applicable.
Communal areas	Circulation areas visually inspected.
	There is a shared entrance, stairwell and landings which are accessed by a timber/glazed security door. Communal lighting is provided. There is a glazed cupola over the common stairwell.

Garages and permanent outbuildings	Visually inspected.
	There is a residents' garage at basement level. We have been advised that the property has one large designated parking space.
	•
Outside areas and boundaries	Visually inspected.

	The property has an enclosed communal garden/courtyard which is suitably bounded.
Ceilings	Visually inspected from floor level.
	The ceilings are plasterboard.

Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	The internal walls are a mixture of masonry and proprietary hollow core partitions. The solid walls are plastered. The timber framed walls are lined with plasterboard.

Floors including sub floors	The floors are suspended timber construction.
Internel is included and bitchess fitting	
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	The internal doors are timber and timber/glazed. The skirting boards and door surrounds are timber. The bedroom has built-in wardrobes with mirrored doors. Kitchen fittings comprise a range of dated floor and wall mounted units and work surfaces.

Chimney breasts and fireplaces	Not applicable.
Internal decorations	Visually inspected.
	The walls are mainly painted and part tiled. The ceilings are mainly Artexed. The joinery is finished with a decorative stain.
Cellars	Visually inspected where there was a safe and purpose-built access.
	Not applicable.

Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Electricity is supplied from the mains. The meter and consumer unit are boxed in and located in the hall cupboard. The system appears to be a modern 13 amp type and design. The switch and socket outlets are plastic and the wiring is sheathed in PVC, where visible.
-------------	--

Gas	Not applicable.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	Water is supplied from the mains. The pipework is a mixture of


copper and PVC manufacture, where visible. The cold water storage tank is plastic and is located in the hall cupboard. The internal stop tap is located beneath the kitchen sink. The bathroom has a three piece suite with wash-hand basin, WC and bath.

Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.
	No tests whatsoever were carried out to the system or appliances.
	The property is heated by electric storage and panel heaters. Hot water is stored in a cylinder which is located in the hall cupboard. Two immersion heaters are fitted (not tested).

Drainage	Drainage covers etc were not lifted.	
	Neither drains nor drainage systems were tested.	
	The property is believed to be connected to mains drainage.	

Fire, smoke and burglar alarms	Visually inspected.
	No tests whatsoever were carried out to the system or appliances.
	The property has a smoke detector, common fire alarm system and door entry system with intercom.

Any additional limits to inspection	For flats / maisonettes
	Only the subject flat and internal communal areas giving access to the flat were inspected.
	If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.
	The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.
	The property was unoccupied and part furnished with fixed floor coverings throughout. The roof space over the common stairwell has been inspected. The remaining roof spaces have not.

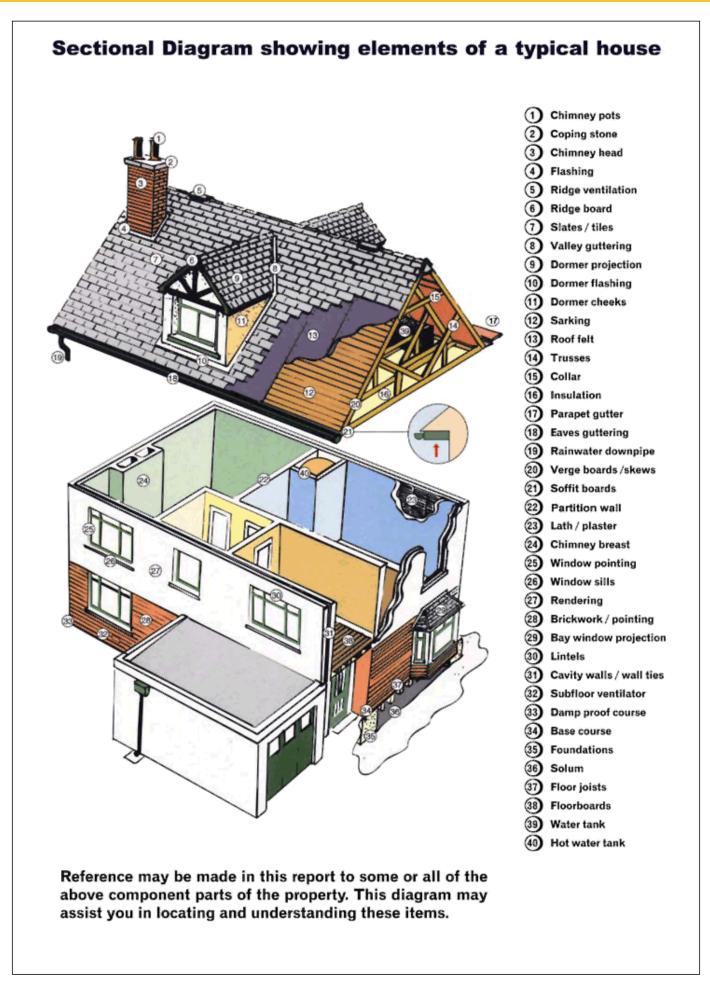

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category	1
Notes	No visible evidence of significant structural movement was noted within the limitations of the inspection.

Dampness, rot and infestation	
Repair category	1
Notes	No obvious significant dampness, timber decay or infestation was noted, within the limitations imposed on the inspection.

Chimney stacks	
Repair category	-
Notes	

Roofing including roof space	
Repair category	1
Notes	Roof slating, where viewed from ground level, appears to have been laid to generally even courses with no obvious significant defects noted.
	The flat roof coverings appear satisfactory and there was no evidence of defects internally to indicate it is anything other than satisfactory. It should be noted that flat roofs have a limited life and generally require higher than average levels of maintenance.
	The roof structure appears satisfactory.

Rainwater fittings	
Repair category	1
Notes	No significant disrepair was noted to the rainwater goods. It will, however, be appreciated that the inspection was carried out during dry weather conditions. Sometimes defects in rainwater goods are only apparent during, or after heavy rainfall.

Main walls	
Repair category	1
Notes	The main walls are in satisfactory structural order.
	No obvious significant defects were noted to accessible wall surfaces.

Windows, external doors and joinery	
Repair category	2
Notes	The windows are serviceable, although a number of seals have failed resulting in interstitial condensation to some of the windows. These require repair/replacement. No obvious significant defects were noted to the entrance door. The fascia boards and soffits at the eaves of the roof generally appeared satisfactory.

External decorations	
Repair category	1
Notes	The external decorations are generally satisfactory allowing for normal weathering.

Conservatories/porches	
Repair category	-
Notes	

Communal areas	
Repair category	1
Notes	No obvious significant defects were noted to the communal areas.

Garages and permanent outbuildings	
Repair category	1
Notes	No obvious significant defects were noted to the garage.

Outside areas and boundaries	
Repair category	1
Notes	Outside areas and boundaries appear satisfactory for age and type.

Ceilings	
Repair category	1
Notes	The ceilings are satisfactory. The Artex ceiling finish may contain asbestos fibres. This can only be determined by taking a sample for analysis. Even if the ceiling finish does contain asbestos fibres it is not normally considered to be a health hazard provided it is not disturbed, for example it should not be rubbed down during redecoration.

Internal walls	
Repair category	1
Notes	No obvious significant defects were noted to the internal walls.

Floors including sub-floors	
Repair category	1
Notes	No obvious significant defects were noted to flooring, within the limitations imposed by fully- fitted floor coverings.

Internal joinery and kitchen fittings	
Repair category	2
Notes	The internal joinery is generally satisfactory for age and type. The kitchen fittings are serviceable, but dated.

Chimney breasts and fireplaces	
Repair category	-
Notes	

Internal decorations	
Repair category	1
Notes	The internal decorations are generally satisfactory.

Cellars	
Repair category	-
Notes	

Electricity	
Repair category	1
Notes	No obvious significant defects were noted to the electrical installation. It is recommended good practice that all electrical installations are checked periodically, approximately every ten years or when a property changes hands. This should be regarded as a routine safety and maintenance check.

Gas	
Repair category	-
Notes	

F Water, plumbing and bathroom fittings	
Repair category	1
Notes	No obvious significant defects were noted to accessible plumbing or sanitary fittings.

Heating and hot water	
Repair category	1
Notes	No obvious significant defects were noted to the heating system or hot water system, although these have not been tested.

Drainage	
Repair category	1
Notes	No obvious significant defects were noted to the drainage system, within the limitations of the inspection.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	
Roofing including roof space	1
Rainwater fittings	1
Main walls	1
	2
Windows, external doors and joinery External decorations	
	1
Conservatories/porches	-
Communal areas	1
Garages and permanent outbuildings	1
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	-
Internal decorations	1
Cellars	-
Electricity	1
Gas	-
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	First Floor
2. Are there three steps or fewer to a main entrance door of the property?	Yes No X
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes X No
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The legal adviser should check existence and details of acceptable management arrangements, service charges and block insurance.

The legal adviser should verify if there are any proposed common repairs works that will incur significant charges.

The property has a designated parking space. Details to be verified.

In line with our normal practice, it is specifically assumed that the property and its value are unaffected by any matters which would or should be revealed to a competent Completing Solicitor by a local search and replies to the usual enquiries, or by any statutory notice and planning proposal.

Estimated reinstatement cost for insurance purposes

£125,000 (One hundred and twenty five thousand pounds sterling).

The rebuilding cost for insurance purposes is for the subject property only and is given solely as a guide as it is assumed the building as a whole is insured under a single policy.

Valuation and market comments

In its present condition, the opinion of valuation for the Outright Ownership interest with vacant possession on 28th July 2017 is £120,000 (One Hundred and Twenty Thousand Pounds Sterling).

Signed	Security Print Code [453631 = 7681]
	Electronically signed

Report author	Alan Weir

Company name	Harvey Donaldson And Gibson

Address	Suite 3/7 Standard Buildings, 94 Hope Street, Glasgow, G2 6PH

Date of report 31st July 2017	
---------------------------------	--

Mortgage Valuation Report



Property Address	
Address Seller's Name Date of Inspection	Flat 1/1, 72 Brown Street, Glasgow, G2 8PD Mr T Stodart 28th July 2017
Property Details	
Property Type	House Bungalow Purpose built maisonette Converted maisonette X Purpose built flat Converted flat Tenement flat Flat over non-residential use Other (specify in General Remarks)
Property Style	Detached Semi detached Mid terrace End terrace Back to back High rise block X Low rise block Other (specify in General Remarks)
Does the surveyor be e.g. local authority, m	lieve that the property was built for the public sector, Yes X No ilitary, police?
Flats/Maisonettes onl	y Floor(s) on which located 1 No. of floors in block 4 Lift provided? Yes X No
Approximate Year of	No. of units in block 12 Construction 1990
Tenure	
X Absolute Ownership	Leasehold Ground rent £ Unexpired years
Accommodation	
Number of Rooms	1 Living room(s) 1 Bedroom(s) 1 Kitchen(s) 1 Bathroom(s) 0 WC(s) 0 Other (Specify in General remarks)
	cluding garages and outbuildings) 51 m ² (Internal) 61 m ² (External)
Residential Element ((greater than 40%) X Yes No
Garage / Parking /	Outbuildings
Single garage Available on site?	Double garage X Parking space No garage / garage space / parking space X Yes No
Permanent outbuildin	gs:
None.	

Mortgage Valuation Report

Construction									
Walls	X Brick	Stone	Con	crete [Timber fr	ame	Oth	er (specify in Ge	neral Remarks)
Roof	Tile	X Slate	Asp	halt [Felt		Oth	er (specify in Ge	neral Remarks)
Special Risks									
Has the property s	suffered struct	ural moveme	ent?					Yes	X No
If Yes, is this recei	nt or progress	ive?						Yes	No
Is there evidence, immediate vicinity		ison to antici	pate subsic	lence, he	eave, land	slip o	r flood in th	ie Yes	X No
If Yes to any of the	e above, provi	de details in	General Re	emarks.					
Service Connec	tion								
Based on visual in of the supply in Ge			ces appear	to be no	n-mains, p	blease	e comment	on the type a	nd location
Drainage	X Mains	Private	None		Wa	iter	X Mains	Private	None
Electricity	X Mains	Private	None		Ga	s	Mains	Private	X None
Central Heating	X Yes	Partial	None						
Brief description o	f Central Heat	ing:							
Site									
Apparent legal iss	ues to be verif	ied by the co	onveyancer	. Please	provide a	brief	description	in General R	emarks.
Rights of way	Shared drive	es / access	Garage o	r other am	enities on se	parate	site Sh	ared service con	nections
Ill-defined boundari	ies	Agricult	tural land inclu	ded with p	roperty		Oth	ner (specify in Ge	eneral Remarks)
Location									
Residential suburb	Res	dential within to	wn / city	K Mixed re	esidential / co	ommer	cial 🗌 Ma	inly commercial	
Commuter village	Rem	ote village		Isolated	rural proper	ty	Oth	ner (specify in Ge	eneral Remarks)
Planning Issues	5								
Has the property b If Yes provide deta			/ altered?	Yes	X No				
Roads									
X Made up road	Unmade road	Partly	completed ne	w road	Pedes	trian ad	ccess only	Adopted	Unadopted

General Remarks

The subjects comprise a purpose-built, first floor flat in a four storey block which contains twelve flats. The building has a basement garage and we have been advised the property has one designated parking space.

The property is situated in an area of mixed residential and commercial use in central Glasgow. Surrounding properties are of mixed type and character. Usual city centre amenities are available nearby. The general condition of the property appears consistent with its age and type of construction. A number of items were noted which should be capable of remedy by normal repair and maintenance.

Essential Repairs

None.			
Estimated cost of essential repairs £	Retention recommended?	No	Amount £

Mortgage Valuation Report

Comment on Mortgageability

The property affords adequate security for loan purposes based on the valuation figure.

Valuations	
Market value in present condition	£ 120,000
Market value on completion of essential repairs	£
Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)	£ 125,000
Is a reinspection necessary?	Yes X No
Buy To Let Cases	
What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis?	£
Is the property in an area where there is a steady demand for rented accommodation of this type?	Yes No
Declaration	

Signed	Security Print Code [453631 = 7681] Electronically signed by:-
Surveyor's name	Alan Weir
Professional qualifications	MRICS
Company name	Harvey Donaldson And Gibson
Address	Suite 3/7 Standard Buildings, 94 Hope Street, Glasgow, G2 6PH
Telephone	0141 204 0808
Fax	0141 248 3636
Report date	31st July 2017

Energy Performance Certificate (EPC)

Scotland

Dwellings

FLAT 1/1, 72 BROWN STREET, GLASGOW, G2 8PD

Dwelling type:	Mid-floor flat
Date of assessment:	28 July 2017
Date of certificate:	31 July 2017
Total floor area:	51 m ²
Primary Energy Indicator:	348 kWh/m²/year

Reference number: Type of assessment: Approved Organisation: Main heating and fuel:


2182-1000-7203-5323-5904 RdSAP, existing dwelling Elmhurst Electric storage heaters

You can use this document to:


- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£1,602	See your recommendations
Over 3 years you could save*	£264	report for more information

 st based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

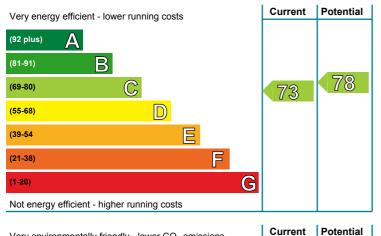

Very environmentally friendly - lower CO₂ emissions

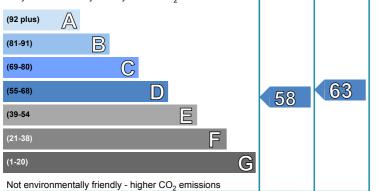

Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is band C (73). The average rating for EPCs in Scotland is band D (61).

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D** (58). The average rating for EPCs in Scotland is band D (59).

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years	Available with Green Deal
1 Low energy lighting	£15	£48.00	
2 High heat retention storage heaters	£1,200 - £1,800	£213.00	

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.



The Green Deal may allow you to make your home warmer and cheaper to run at no up-front capital cost. See your recommendations report for more details.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE **DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE**

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, insulated (assumed)	★★★ ☆	★★★★☆
Roof	(another dwelling above)	—	
Floor	(another dwelling below)	—	_
Windows	Fully double glazed	★★★☆☆	★★★☆☆
Main heating	Electric storage heaters	★★★☆☆	$\bigstar & & & & & & & \\ \bigstar & & & & & & & & \\ \bigstar & & & &$
Main heating controls	Manual charge control	★★☆☆☆	★★☆☆☆
Secondary heating	Room heaters, electric	—	_
Hot water	Electric immersion, off-peak	★★★☆☆	★★☆☆☆
Lighting	Low energy lighting in 50% of fixed outlets	★★★ ☆	★★★★☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 59 kg $CO_2/m^2/yr$.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 3.0 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.3 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

FLAT 1/1 , 72 BROWN STREET, GLASGOW, G2 8PD 31 July 2017 RRN: 2182-1000-7203-5323-5904

Estimated energy	costs for this home		
	Current energy costs	Potential energy costs	Potential future savings
Heating	£972 over 3 years	£774 over 3 years	
Hot water	£432 over 3 years	£432 over 3 years	You could
Lighting	£198 over 3 years	£132 over 3 years	save £264
Tota	ls £1,602	£1,338	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Do		Indianting and Typical sav		Rating after	Green	
Re	commended measures	Indicative cost	per year	Energy	Environment	Deal
1	Low energy lighting for all fixed outlets	£15	£16	C 74	D 59	
2	High heat retention storage heaters	£1,200 - £1,800	£71	C 78	D 63	Ø

Measures which have a green deal tick \bigcirc are likely to be eligible for Green Deal finance plans based on indicative costs. Subsidy also may be available for some measures, such as solid wall insulation. Additional support may also be available for certain households in receipt of means tested benefits. Measures which have an orange tick \bigcirc may need additional finance. To find out how you could use Green Deal finance to improve your property, visit www.greenerscotland.org or contact the Home Energy Scotland hotline on 0808 808 2282.

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Air or ground source heat pump

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Low energy lighting

Replacement of traditional light bulbs with energy saving recommended ones will reduce lighting costs over the lifetime of the bulb, and they last up to 12 times longer than ordinary light bulbs. Also consider selecting low energy light fittings when redecorating; contact the Lighting Association for your nearest stockist of Domestic Energy Efficient Lighting Scheme fittings.

2 High heat retention storage heaters

Modern storage heaters have better insulation and are easier to control than the older type in this property. Ask for a quotation for new, high heat retention heaters with automatic charge and output controls. Installations should be in accordance with the current regulations covering electrical wiring. Ask the heating engineer to explain the options, which might also include switching to other forms of electric heating.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to www.energysavingtrust.org.uk/scotland/rhi.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	3,615	N/A	N/A	N/A
Water heating (kWh per year)	1,822			

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Assessor membership number: Company name/trading name: Address:	Mr. Alan Weir EES/016095 Harvey Donaldson & Gibson Chartered Surveyors Suite 3/7 Standard Buildings 94 Hope Street Glasgow G2 6PH
Phone number:	0141 204 0808
Email address:	alan.weir@hdg.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Opportunity to benefit from a Green Deal on this property

Under a Green Deal, the cost of the improvements is repaid over time via a credit agreement. Repayments are made through a charge added to the electricity bill for the property.

To see which improvements are recommended for this property, please turn to page 3. You can choose which improvements you want to install and ask for a quote from an authorised Green Deal provider. They will organise installation by an authorised Green Deal installer. If you move home, the responsibility for paying the Green Deal charge under the credit agreement passes to the new electricity bill payer.

For householders in receipt of income-related benefits, additional help may be available.

To find out more, visit www.greenerscotland.org or call 0808 808 2282.



Property Questionnaire

Property Address	1/1 72 Brown Street
	GLASGOW
	G2 8PD

Seller(s) Mr Thelma Stodart

Completion date of property questionnaire	24/08/2017
---	------------

1 Length of ownership

How long have you owned the property? $\ensuremath{\mathsf{N/A}}$

2 Council tax

Which Council Tax band is your property in?

D

3 Parking

What are the arrangements for parking at your property?

(Please	tick	all	that	apply)
(0000		~		~~~/

Garage	
Allocated parking space	\checkmark
Driveway	
Shared parking	
On street	
Resident permit	
Metered parking	
Other (please specify)	

4 Conservation area

Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?

No

5 Listed buildings

Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)? No

6 Alterations/additions/extensions

a.(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? No

If you have answered yes, please describe below the changes which you have made:

(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?

If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:

b. Have you had replacement windows, doors, patio doors or double glazing installed in your property?

No

If you have answered yes, please answer the three questions below:

- (i) Were the replacements the same shape and type as the ones you replaced?
- (ii) Did this work involve any changes to the window or door openings?
- (iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):

Please give any guarantees which you received for this work to your solicitor or estate agent.

7 Central heating

a. Is there a central heating system in your property?

(Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom). Yes

If you have answered yes or partial — what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). Electric

If you have answered yes, please answer the three questions below:

- (i) When was your central heating system or partial central heating system installed? dont know
- (ii) Do you have a maintenance contract for the central heating system? No

If you have answered yes, please give details of the company with which you have a maintenance contract:

(iii) When was your maintenance agreement last renewed? (Please provide the month and year).

8 Energy Performance Certificate

Does your property have an Energy Performance Certificate which is less than 10 years old?

Yes

9 Issues that may have affected your property

a. Has there been any storm, flood, fire or other structural damage to your property while you have owned it?

No

If you have answered yes, is the damage the subject of any outstanding insurance claim?

b. Are you aware of the existence of asbestos in your property?

No

If you have answered yes, please give details:

10 Services

Please tick which services are connected to your property and give details of the supplier:

Services	Connected	Supplier	
Gas or liquid petroleum gas			
Water mains or private water supply	\checkmark	Scottish Water	
Electricity	\checkmark	Don't know	
Mains drainage	\checkmark	Scottish Water	
Telephone			
Cable TV or satellite			
Broadband			
Is there a septic tank system at your property?			

No

b.

- Do you have appropriate consents for the discharge from your septic tank? (i)
- Do you have a maintenance contract for your septic tank? (ii)

If you have answered yes, please give details of the company with which you have a maintenance contract:

11 Responsibilities for shared or common areas

Are you aware of any responsibility to contribute to the cost of anything used jointly, such as a. the repair of a shared drive, private road, boundary, or garden area? Don't know

If you have answered yes, please give details:

b. Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?

Yes

If you have answered yes, please give details:

Factors Redpath Bruce

Has there been any major repair or replacement of any part of the roof during the time you c. have owned the property?

No

d. Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries? No

If you have answered yes, please give details:

As far as you are aware, do any of your neighbours have the right to walk over your e. property, for example to put out their rubbish bin or to maintain their boundaries? No

If you have answered yes, please give details:

f. As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)

No

If you have answered yes, please give details:

12 Charges associated with your property

a. Is there a factor or property manager for your property? Yes

Redpath Bruce

b. Is there a common buildings insurance policy?

Yes

If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?

Yes

c. Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.

13 Specialist works

a. As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?

No

If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.

b. As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?

No

If you have answered yes, please give details:

c. If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?

If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate., these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried by the purchaser and should be given to your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.

Guarantees are held by:

14 Guarantees

- a. Are there any guarantees or warranties for any of the following:
- (i) Electrical work
 - No
- (ii) Roofing

No

(iii) Central heating

No

- (iv) National House Building Council (NHBC)
- (v) Damp course No
- (vi) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)
 No
- b. If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):
- (i) Electrical work
- (ii) Roofing
- (iii) Central heating
- (iv) National House Building Council (NHBC)
- (v) Damp course
- (vi) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)
- c. Are there any outstanding claims under any of the guarantees listed above?

If you have answered yes, please give details:

15 Boundaries

So far as your are aware, has any boundary of your property been moved in the last 10 years?

No

If you have answered yes, please give details:

16 Notices that affect your property

In the past three years have you ever received a notice:

- a. advising that the owner of a neighbouring property has made a planning application? No
- b. that affects your property in some other way?
 - No
- c. that requires you to do any maintenance, repairs or improvements to your property? No

If you have answered yes to any of a–c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.